


O-Ring Boss Fittings

PRESSURE CONNECTIONS CORP.

6801L Straight Thread Elbow Long

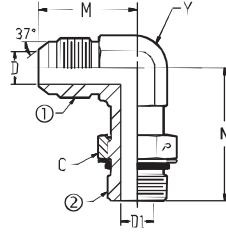

SAE 071520

Ref. Weatherhead C5515L

6801L-①-② ① -MJ ② -MB	Tube O.D.	① Male JIC	② Male ORB	C Nut Hex	D Drill	D1 Drill	M Length	N Length	Y Flats	Operating Pressure
6801L-02-02-4	1/8	5/16 - 24	5/16 - 24	7/16	0.062	0.062	0.77	1.31	7/16	5,000
6801L-03-03-4	3/16	3/8 - 24	3/8 - 24	1/2	0.125	0.125	0.83	1.39	7/16	5,000
6801L-04-04-4	1/4	7/16 - 20	7/16 - 20	9/16	0.172	0.172	0.89	1.54	7/16	6,000
6801L-05-05-4	5/16	1/2 - 20	1/2 - 20	5/8	0.234	0.234	0.95	1.57	9/16	6,000
6801L-06-06-4	3/8	9/16 - 18	9/16 - 18	11/16	0.297	0.297	1.06	1.66	9/16	6,000
6801L-08-08-4	1/2	3/4 - 16	3/4 - 16	7/8	0.391	0.391	1.25	1.97	3/4	6,000
6801L-08-10-4	1/2	3/4 - 16	7/8 - 14	1"	0.391	0.484	1.35	2.26	7/8	5,000
6801L-10-10-4	5/8	7/8 - 14	7/8 - 14	1"	0.484	0.484	1.45	2.26	7/8	5,000
6801L-12-12-4	3/4	1 1/16 - 12	1 1/16 - 12	1 1/4	0.609	0.609	1.66	2.62	1 1/16	5,000
6801L-16-16-4	1"	1 5/16 - 12	1 5/16 - 12	1 1/2	0.844	0.844	1.81	3.06	1 5/16	4,000
6801L-20-20-4	1 1/4	1 5/8 - 12	1 5/8 - 12	1 7/8	1.078	1.078	2.06	3.48	1 5/8	4,000
6801L-24-24-4	1 1/2	1 7/8 - 12	1 7/8 - 12	2 1/8	1.312	1.312	2.33	3.93	1 7/8	3,000
6801L-32-32-4	2"	2 1/2 - 12	2 1/2 - 12	2 3/4	1.781	1.781	3.06	4.46	2 5/8	2,000

4:1 Safety Factor

O-Ring Boss information is on pages 130-131, 155.

O-Ring Boss
Fittings

i Informational Tips

We're Easy To Do
Business With !



Order in Your Numbers
Same Day Shipping

No Minimum Order
Friendly People

(614) 863-6930 - FAX (614) 864-1327